

Oakland High School Improvement Plan

- 1 Park Boulevard at MacArthur Boulevard**
 - Replace existing yellow transverse crosswalks with high-visibility yellow ladder crosswalks
 - Install truncated domes at all curb ramps
 - Consider construction of a curb extension on the southwest corner
 - Consider a Leading Pedestrian Interval (LPI) for pedestrians crossing Park Blvd
 - Install NO RIGHT TURN ON RED signage for eastbound drivers on MacArthur Blvd

- 2 Park Boulevard at E 34th Street**
 - Replace existing yellow transverse crosswalks with high-visibility yellow ladder crosswalks
 - Install truncated domes at all curb ramps
 - Consider relocating the stoplight at E 33rd Street to E 34th Street

- 3 MacArthur Boulevard at Alma Avenue**
 - Replace existing white transverse crosswalks with high-visibility yellow ladder crosswalks
 - Install truncated domes at all curb ramps
 - Consider construction of a curb extension at the southeast corner of intersection
 - Install SLOW SCHOOL CROSSING pavement markings in advance of uncontrolled crossing

Option A


- Install Assembly D signage on MacArthur Blvd in advance of Alma Avenue and Assembly B signage with rapid-rectangular flashing beacons (RRFBs) at the crossing
- Install speed feedback signs in advance of crossing in both directions

Option B


- Study a STOP warrant at Alma Avenue instead of Assembly signage in **Option A**
- Install mid-block crossing approximately 400 feet east of Alma Avenue, with Assembly signage listed in **Option A**, construct curb extension on southern end of crossing
- Install speed feedback sign in advance of the crossing for westbound traffic

- 4 MacArthur Boulevard**
 - Consider constructing a sidewalk on the northern side of the street from Alma Avenue to approximately 400 feet to the east
 - Stripe red curb on the northern side of the street from the end of the proposed sidewalk to approximately 100 feet to the east

- 5 Median on MacArthur Boulevard**
 - Install fencing along the concrete median to discourage uncontrolled crossings there

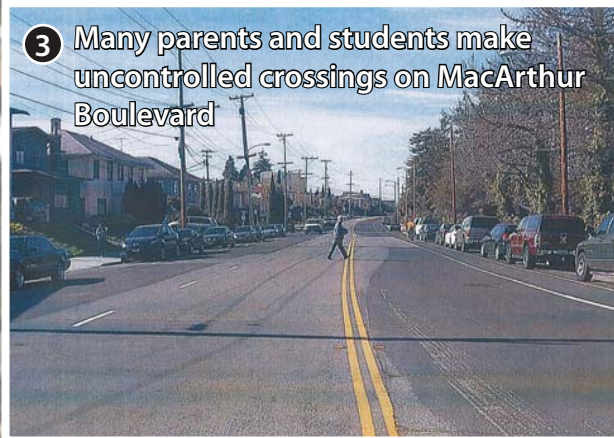

3 Many parents and students make uncontrolled crossings on MacArthur Boulevard

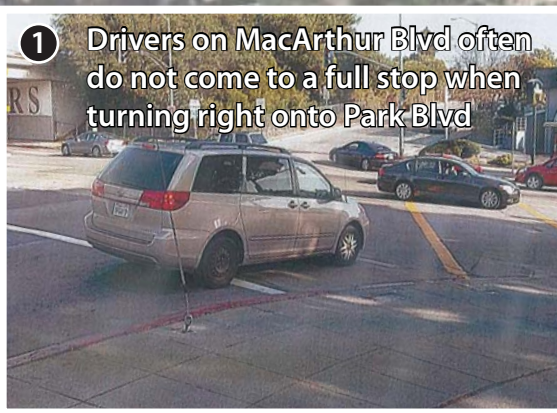

1 Drivers on MacArthur Blvd often do not come to a full stop when turning right onto Park Blvd



- improvements not to scale
- (L) Existing Loading Zone
- (Bus icon) Existing Bus Stop

